


Tech Bulletin - Rockcrawler Side Guards - CJ, YJ and TJ*

There have been several cases of squeaking coming from the installation of our side guards on models with worn or over-compressed body mount bushings. This issue has been found mostly on TJ's, though there have been reports from at least one CJ and YJ owner. The issue has been identified as the top of the mounting channels slightly rubbing the underside of the body-mount outriggers during frame twist from entering and / or exiting uneven driveways, dips, etc. The only solution is to shim the mounting channels on the body-mount bushings to space the channels down and off the outriggers.

If you encounter squeaking after installing your side guards, a simple 1/8" thick x 2" o.d. washer between each channel and body-mount bushing will space the channels off the outriggers just enough to resolve and prevent this noise.

If you need the forementioned washers, we will supply them at no charge to you. Contact us during our normal business hours with your shipping information.

1/8" thick x 2" o.d. washers

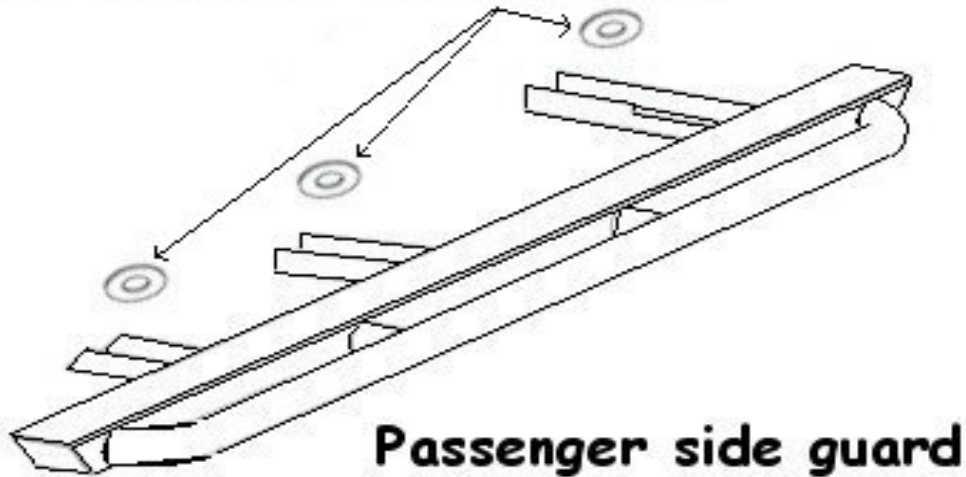

Check out our website for the latest in Body Armor gear, tech bulletins, and our new vehicle photo gallery.

© 2007 BodyArmor 4x4 All rights reserved.
258 Mariah Circle, Corona, California 92879
951-808-0750, Fax: 951-808-0041, Email: info@bodyarmor4x4.com