

## Tech Bulletin 4/3/06

Certain models of Jeep TJ's are found to have fitment issues with the rear Swing-A-Way bumper # TJ-2991 and # TJ-2491. The models affected include Sport, Rubicon, Unlimited and Rubicon Unlimited.

Investigation has revealed that the Jeep cross member is indeed the problem, not our bumper. (We have examined the aforementioned models on a dealership's showroom floor and discovered that the cross member was cantilevered in toward the tailgate by approximately 3 degrees). This will not allow the swing arm to align and close properly.

Although it does not affect every TJ, it affects the majority.

A 1/8" spacer or shim has proven to solve the problem. It will fit between the outside of the cross member and the bumper and will be secured by the top L bracket bolt. The result is that the top of the bumper is realigned to 90 degrees square and the swing arm attaches and closes without any interference. We will continue to provide, at no charge, 1/8" washers to any customer that encounters a problem. For those customers who prefer not to wait, they may use a 1/8" washer, shim, or equivalent to realign the cross member as indicated above.

If you have any questions regarding this Tech Bulletin, please contact Customer Service / Tech Service @ 951-808-0750.